



ELECTRICAL CHARACTERISTICS:

This filter satisfies Table 1 at Temperature Range : -40 to +85°C

CENTER FREQUENCY :fo=5665 MHz

PASSBAND WIDTH :5480~5850 MHz

INPUT/OUTPUT IMPEDANCE :50 Ω

Max. INPUT POWER :1 W

Moisture Sensitivity Levels : 2a



CDR3007

5665 MHz **Ceramic Filter**


Package Dimensions

8.46 x 3.45 x 3 mm

NO.	ITEM	SPECIFICATION					
NO.	I I EM	min	typ	max			
1	PASS BAND INSEF		1.5 dB	2.0 dB			
2	PASS BAND F		0.8 dB	1.5 dB			
3	PASS BAND RET	10 dB	12 dB				
4	STOP—BAND ATTENUATION	at 5150~5340 MHz	35 dB	38dB			
Item NO.4 specifies the absolute value of attenuation.							

TABLE 1

TYPICAL ELECTRICAL CHARACTERISTICS

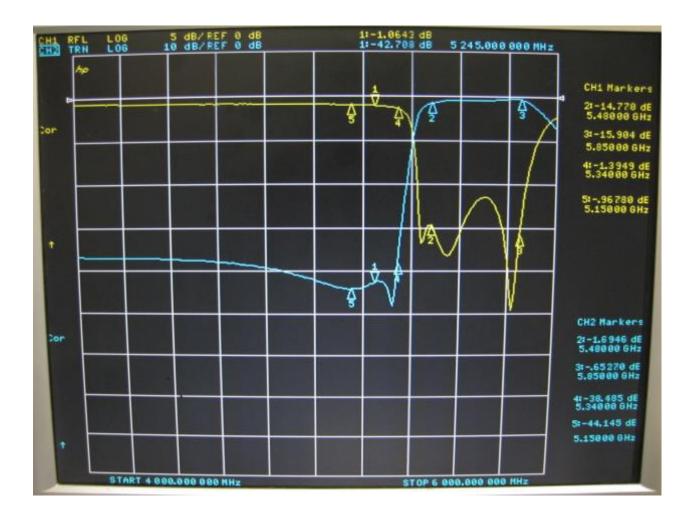

2. Recommended Reflow Soldering Profile

The products can be assembled following Pb-free assembly. According to the Standard IPC/ JEDEC J-STD-020C, the temperature profile suggested is as follow:

Profile Feature	Pb-Free Assembly			
Average ramp-up rate (Tsmax to Tp)	3° C/second max.			
Preheat - Temperature Min (Ts _{min}) - Temperature Max (Ts _{max}) - Time (Ts _{min} to Ts _{max}) (ts)	150 °C 200 °C 60-180 seconds			
 Time maintained above: Temperature (T_L) Time (t_L) 	217 °C 60-150 seconds			
Peak Temperature (Tp)	See Table Pb Free below			
Time within 5°C of actual Peak Temperature (tp) ²	20-40 seconds			
Ramp-down Rate	6 °C/second max.			
Time 25°C to Peak Temperature	8 minutes max.			

Classification Reflow Profiles

Note 1: All temperatures refer to topside of the package, measured on the package body surface.

Note 2: Time within 5 °C of actual peak temperature (tp) specified for the reflow profiles is a "supplier" minimum and "user" maximum.

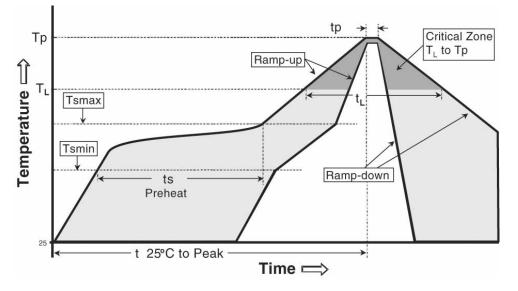



Table Pb-free Process - Package Peak Reflow Temperatures

Package Thickness	Volume mm ³ < 350	Volume mm ³ 350 - 2000	Volume mm ³ > 2000		
< 1.6 mm	260 °C *	260 °C *	260 °C *		
1.6 mm - 2.5 mm	260 °C *	250 °C *	245 °C *		
> 2.5 mm	250 °C *	245 °C *	245 °C *		


* Tolerance: The device manufacturer/supplier shall assure process compatibility up to and including the stated classification temperature at the rated MSL level

3.DIMENSION AND PCB LAYOUT


3-1-1 SHAPE AND DIMENSION

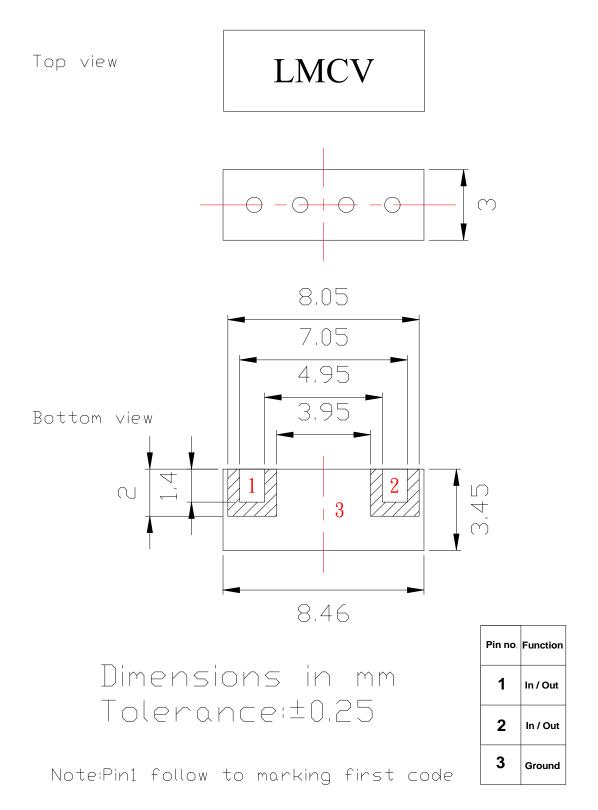

3-1-2 Measurement Circuit

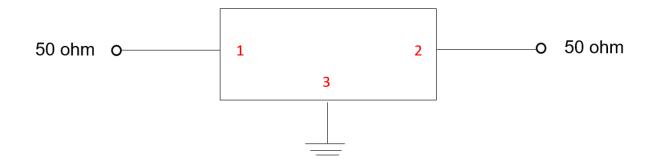

3-1-3 MARKING

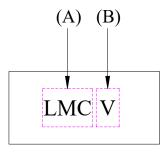

(A) Product name : LMC for 5665Ci(B) Year/Month : Please refer to the Table-1


|--|

Year	Month	Code	Year	Month	Code	Year	Month	Code	Year	Month	Code
2012 2016 2020 2024	1	А	2013 2017 2021 2025	1	Ν	2014 2018 2022 2026	1	Α.	2015 2019 2023 2027	1	Ν.
	2	В		2	Р		2	В.		2	Ρ.
	3	С		3	Q		3	С.		3	Q.
	4	D		4	R		4	D.		4	R.
	5	Е		5	S		5	Ε.		5	S .
	6	F		6	Т		6	F .		6	Τ.
	7	7 G	7	U		7	G.		7	U.	
	8	Н		8	V		8	н.		8	ν.
	9	J		9	W		9	J.		9	Ψ.
	10	K		10	Х		10	К.		10	Χ.
	11	L		11	Y		11	L.		11	Υ.
	12	М		12	Z		12	М.		12	Ζ.

@ 2020 by RFM Integrated Device, Inc. CDR3007 (R) 10/11/2023

www.rfmi.co


3-2 PCB RECOMMENDED PATTERN FOR FILTER

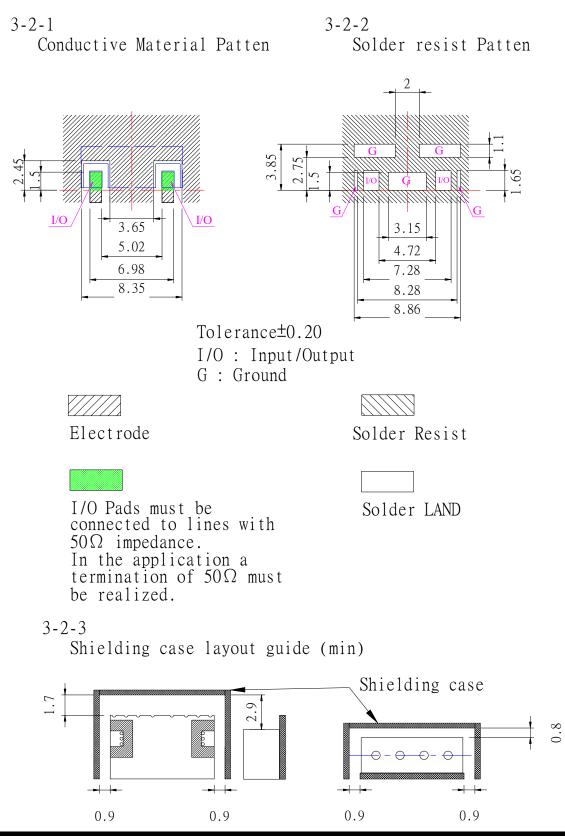


 $\textcircled{\mbox{\sc c}}$ 2020 by RFM Integrated Device, Inc. CDR3007 (R) 10/11/2023

www.rfmi.co

3-3 Delivery mode 3-3-1 Carrier tape

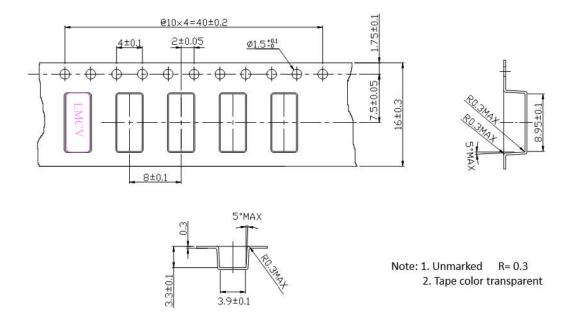


3-3-2 Reel

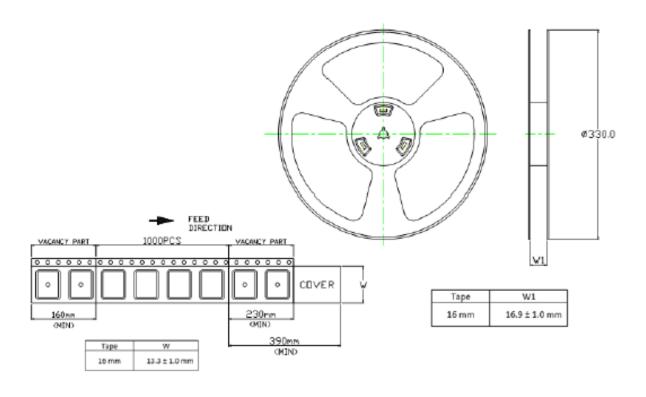

@ 2020 by RFM Integrated Device, Inc. CDR3007 (R) 10/11/2023


1. Duter Carton

QTY: 5000 pcs

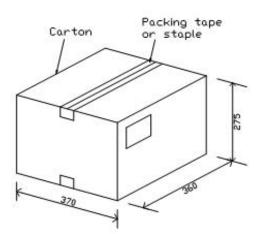


3. Bag

QTY: 1000 pcs

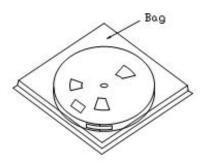


2. Inner Carton

QTY: 1000 pcs

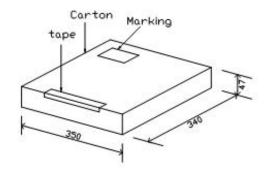

4. Taping

QTY: 1000 pcs

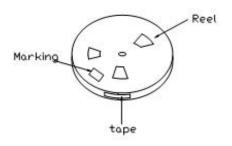

Unitimm

4. STORAGE CONDITIONS:

- **4-1** Use the product of former delivery first.
- **4-2** Temperature: 0° C to 40 $^{\circ}$ C
 - Humidity: 80%RH or less

4-3 The product should not be stored exceeding six months (as packed by the manufacturer) or one month (once unpacked). Use the product within that period.

5.ENVIRONMENTAL RELIABILITY

5-1. STANDARD CONDITION

This standard shall satisfy the condition of Table 1 after the following test 5-2.

5-2. TEST METHOD

- The filter shall withstand the following test condition.
- 5-2-1. Low Temperature Hold Test :-40 $^\circ \! \mathbb{C}$

Unit shall be subjected to the above condition for 10 hours and then be left for more than 2 hours at room temperature.

5-2-2. High Temperature Hold Test:+ 85° C

Unit shall be subjected to the above condition for 10 hours and then be left for more than 2 hours at room temperature.

5-2-3. Humidity Resistance Test:

Unit shall be subjected to the $60\pm 2^{\circ}$ C, 95% relative humidity for 24 hours and then be left for more than 2 hours at $25\pm 5^{\circ}$ C in less than 65% relative humidity.

5-2-4. Vibration Resistance Test:

The vibration frequency shall be varied within 10-60 Hz with the amplitude of 1.5mm for 20 minutes. Devices are applied to vibration in each of three mutually perpendicular planes for 2 hours.

5-2-5. Mechanical Shock Resistance Test:

A half sine wave shock with a maximum acceleration of 30 G's and duration of 11 msec. Unit is applied in six directions at right angles to each other by three shocks in each direction.

5-2-6. Thermal Shock Resistance Test:

After the unit is applied to thermal shock -40° C $\Leftrightarrow +85^{\circ}$ C for 2 hours soak at each temperature with transition time less than 10 seconds for 5 cycles and then be left for more than 1 hour at $25\pm5^{\circ}$ C in less than 65% relative humidity.

5-2-7. Lead Pins Heat Resistance Test: (L type and M type series)

After the lead pins of the unit are soaked in solder bath at 270 $\pm 10^{\circ}$ C for 5 seconds and then be left for more than 1 hour at 25±5°C in less than 65% relative humidity.

5-2-8. Adhesion Test:

The device is subjected to be soldered on test PCB. Then apply 0.5 Kg(5N) of force for 10 ± 1 seconds in the direction of arrow. (the soldering should be done by reflow and be conducted with care so that the soldering is uniform and free of defect by stress such as heat shock).

Solder paste



6. OTHER

6-1. IN CASE OF ANY PROBLEM REGARDING THIS SPECIFICATION, BOTH CUSTOMER AND THE MANUFACTURER SHALL DISCUSS AND SOLVE IT.

6-2. INSTALLING A DIELECTRIC FILTER /DUPLEXER:

6-2-1 How to install dielectric filter/duplexer:

The recommend reflow process for the installation of dielectric filter/duplexer onto PCB. Soldering the dielectric filter/duplexer onto a PCB with a hand soldering iron is not recommended.

6-2-2 Connecting I/Os:

The edge of metal shield, if any, shall be soldered to the electrode of PCB board by reflow process. Tx, Ant, and Rx portion of the PCB shall have either via hole or through hole.

I/Os of the filter/duplexer shall be connected to 50- ohm strip lines that pass through these holes to the backside of the PCB. The 50- ohm strip lines from the duplexer shall be connected to the next circuit element.

It is important to place the filter/duplexer on one side and the connecting strip lines on the other side in order to avoid the interferences by the signal radiation from the strip lines. Such interferences may change the duplexer performance.

6-2-3 Solder and resist area:

Solder and resist area shall be prepared according to referenced Land pattern for each part number provided by the manufacturer. The Referenced Land Pattern may be found in the manufacturer's Product Catalog. The solder area under the filter/ duplexer should be divided into smaller patches with narrow strips of resist area. This is to help the evacuation of the gases generated from the solder paste during reflow process.

6-3 FILTER REPLACEMENT:

6-3-1 Removal of filters:

If filter replacement is necessary, it is recommended that a directed source hot air repair station be used. Use tweezers to handle the filter. Do not expose the filter to temperatures in excess of 220 °C as damage may occur making postmortem difficult.

6-3-2 Installing Replacement Filter:

It is helpful that the filter be preheated to 180 °C before reflow. Pre-tinning the filter with a soldering iron is not recommended due to possible damage generated by a concentrated heat source. Use tweezers to handle the filter. Do not place material handling devices inside of the resonator holes as filter damage may occur. The use of the same silver bearing solder paste is recommended for filter rework or replacement. As with the initial reflow, replacement filters should not be exposed to temperatures in excess of 215 °C.

Disclaimer: The center of this section is presented only as the recommendation or the reference for the use and installation of the dielectric ceramic filter / duplexer. Since the manufacturer does not know any particular conditions, circumstances, and environment of each customer, the manufacturer does not take any responsibility for the consequences caused by use out of this specification document. The readers of this document should examine all possible technical issues regardless of being discussed in this document.

7. FAQ

7-1 Filter/Duplexer functions:

- 7-1-1Max input power?
 - Max input power is largely determined by insertion loss and the volume (mass) of the filter/ duplexer.
 - Consult the manufacturer for the specific value for each part number.
- 8-1-2 What is the function of shielding metal attached to the filter/duplexer?
 - To avoid the deterioration of filter properties (attenuations) by the radiation of electromagnetic wave.
 - To prevent other components from affecting filter properties.
 - To prevent the filter from affecting other components nearby by the radiation of electromagnetic wave.

7-2 Measuring filter and duplexer with test fixture.

- 7-2-1 When the filter/duplexer is measured with a test fixture, the value is different from the values on the inspection report. Why does this happen?
 - Check if the "Thru" correctly adjusted.(When the manufacturer supplies a test fixture, the manufacturer usually informs the adjustment value for insertion loss. Since the measured insertion loss includes the loss of the PCB, it is necessary to deduct from the measured value the adjustment value that is the loss from the PCB.
 - Check if the filter/duplexer securely grounded. Please check if the shielding metal is correctly grounded.

7-2-2 The filter installed in the system does not perform as good as the agreed specifications. Why does this happen?

- Check whether input and output of the PCB is adjusted to Ohms (check if the strip lines are adjusted to 50 ohms. Eliminate any parallel capacitance between Input and output pads. The parallel capacitance is often observed with in PCBs).
- Make sure there are no couplings between Input and Output traces. Make sure there is enough distance between them.
- Make sure there is no metallic components near the filter/duplexer.
- Make sure the filter/duplexer is not deformed nor damaged.
- Make sure the shielding metal is properly grounded to the earth.

7-3 Layout and installation of filters and duplexers:

- 7-3-1 How apart should the filter be placed from the nearby components? How close could the filter be placed near other chip components or metal casing covering RF circuits?
 - If the filter/duplexer has the shielding metal, the shielding metal should not contact other components. Although the filter/duplexer performance is not affected by the metal shield contacting other components, it is recommended that the filter/ duplexer should have a certain distance to other neighboring components. This is to avoid any physical force exerted by other objects nearby which may damage or destroy the filter/duplexer.
 - If there is no shielding metal on the filter/duplexer, the opening surface side shall be 2 to 3 mm apart from the nearby components or objects. (The space shall be equivalent to the height of the ceramic body.)
 - Other surfaces shall have 1 mm spacing to the nearby components.

7-3-2 Land pattern layout and connection of the input and output lines.

- Prepare the PCB according to the recommended land pattern.
- Make sure to ground the shielding metal.
- Keep Input and Output traces as far apart each other as possible.
- 8-3-3 What kind of PCB is recommended for the installation of the filter/duplexer?
 - Is there any recommended thickness of the PCB?
 - There are no restrictions for the thickness of PCBs as far as the lines adjusted to 50 Ohms can be drawn on the PCB. It is however not recommended to use the PC board that is too thin, as the parallel capacitance often occurs in I/O pad area on very thin PCB.
 - The filter /duplexer, in particular those of large size, shall not be installed very near the PCB's fixture or fixture areas (such as bolts to the bases or the chassis), as the deformation of the PCB due to dropping or heat cycles may damage the filter/duplexer.

7-3-4 How shall the filter/duplexer be soldered to PCBs?

- Refer to the recommended land pattern.
- Use reflow oven and follow the manufacturer's recommended reflow temperature profile.
- It is not recommended to use soldering iron or manual soldering.

CAUTION: Electrostatic Sensitive Device. Observe precautions for handling. NOTES:

US or International patents may apply.
 RoHS compliant from the first date of manufacture.

^{1.} The design, manufacturing process, and specifications of this device are subject to change.